

TABELLA RIASSUNTIVA PARAMETRI SALDATURE AD ANGOLO







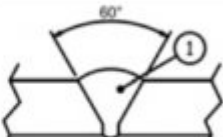
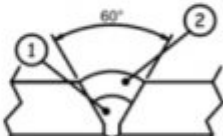
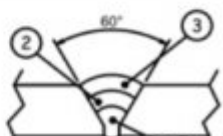
Dimensioni lato cordone mm	Passate a n.	Corrente A ($\pm 20A$)	Tensione V ($\pm 2V$)	Velocità di saldatura cm/1 ($\pm 5cm/1$)	Configurazione delle passate
3 X 3	1	160	26	80	
4 X 4		180	27	70	
5 X 5		210	27	50	
6 X 6		210	27	35	
7 X 7		210	27	25	
8 X 8	1 2	210	27	50 30	
10 X 10	1 2-3	220	28	50 40	
12 X 12	1 2-4	220	28	35 40	
15 X 15	1 2-6	240	239	50 45	
20 X 20	1 2-3 4-10	240	29	40 50 40	

TABELLA RIASSUNTIVA PARAMETRI SALDATURE TESTA A TESTA

Dimensioni lato cordone mm	Passata n.	Corrente A ($\pm 20A$)	Tensione V ($\pm 2V$)	Velocità di saldatura cm/1 ($\pm 5cm/1$)	Configurazione delle passate
3 X 3	1	160	26	80	
4 X 4		180	27	70	
5 X 5	1 2	210	27	50	
6 X 6		210	27	35	
8 X 8		210	27	50 30	
10 X 10	1 2-3	220	28	50 40	
12 X 12		220	28	35 40	